



Esempio 7

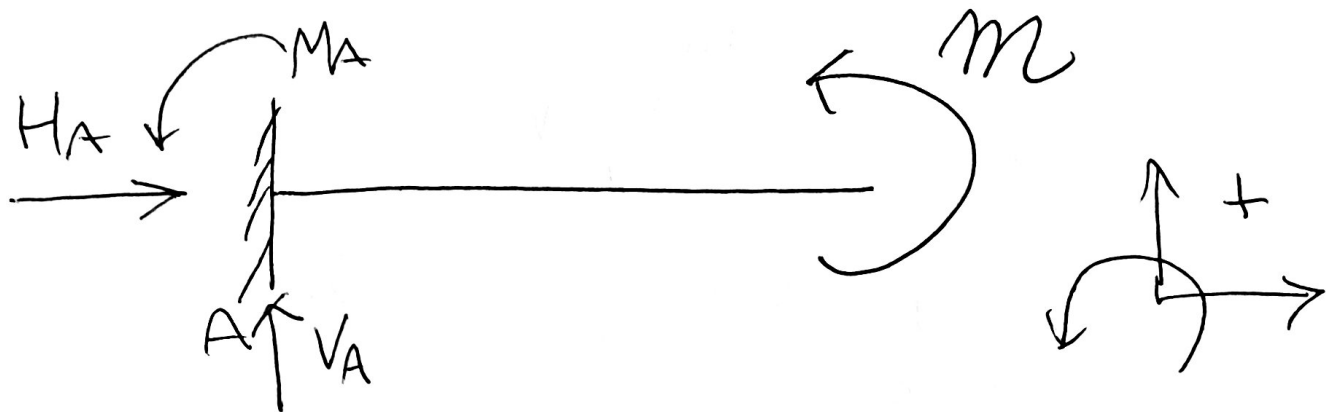


$$\sum F_H = 0 \rightarrow H_A = 0 \rightarrow H_A = 0$$

$$\sum F_V = 0 \rightarrow V_A = 0 \rightarrow V_A = 0$$

$$\sum M_{(A)} = 0 \rightarrow M_A + m = 0 \rightarrow M_A = -m$$

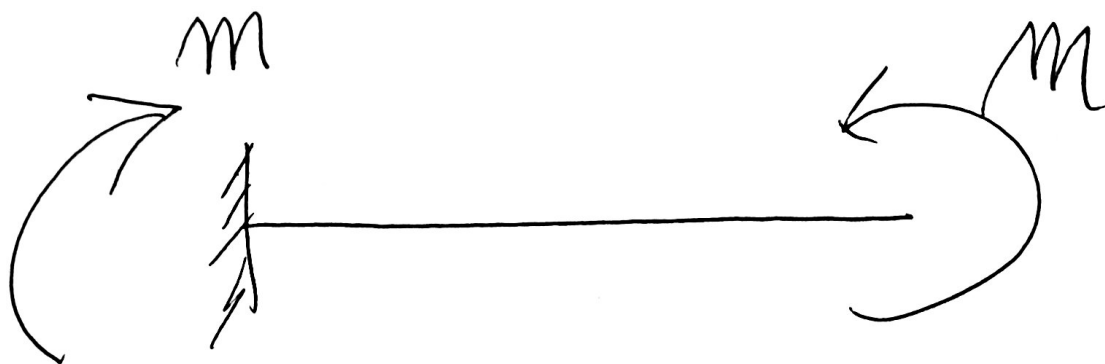


Esempio 8

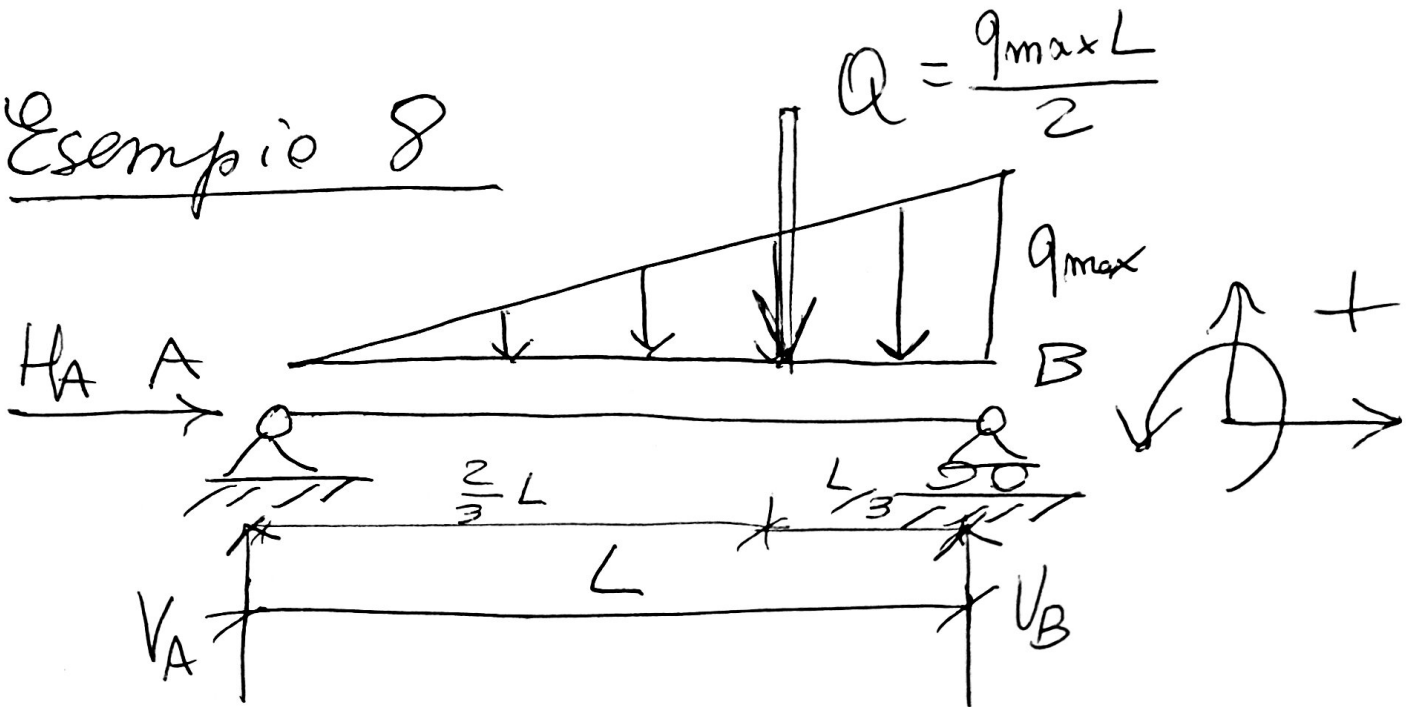


$$\sum F_h = 0 \rightarrow H_A = 0 \rightarrow H_A = 0$$

$$\sum F_v = 0 \rightarrow V_A - Q + V_B = 0 \rightarrow V_A = \frac{q_{\max} L}{6}$$

$$\sum M_{(A)} = 0 \rightarrow -Q \frac{2}{3}L + V_B L = 0 \rightarrow V_B = \frac{q_{\max} L}{3}$$

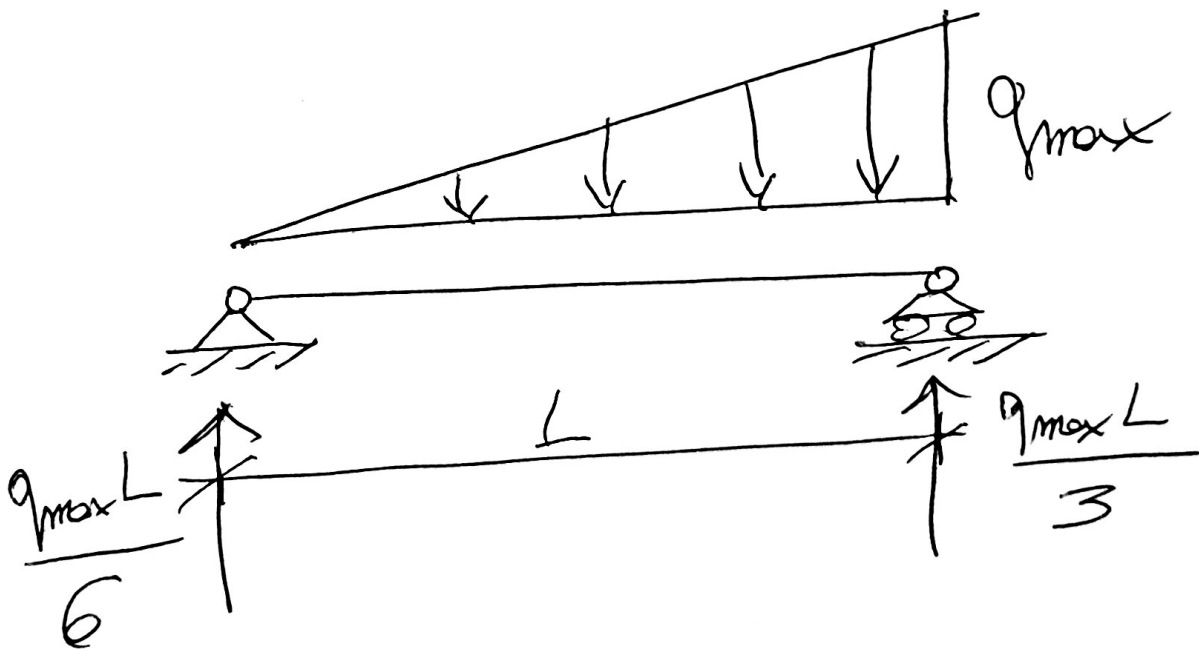

Esempio 9

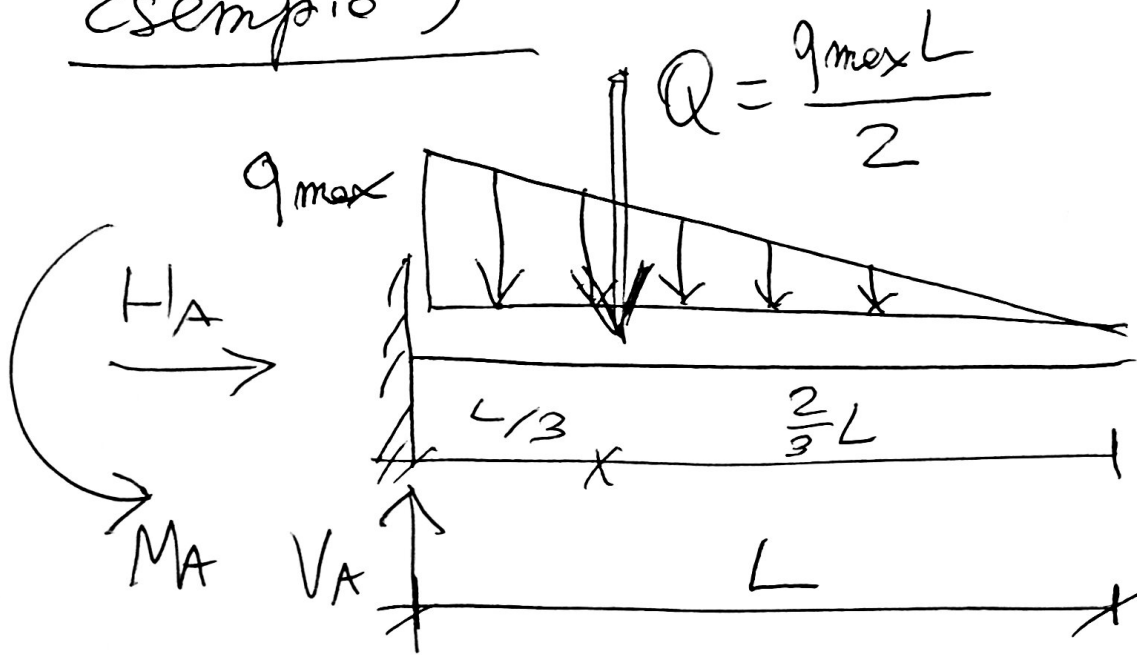

$$\sum F_H = 0 \rightarrow H_A = 0 \rightarrow H_A = 0$$

$$\sum F_V = 0 \rightarrow V_A - Q = 0 \rightarrow V_A = \frac{q_{max} L}{2}$$

$$\sum M_{(A)} = 0 \rightarrow M_A - Q \frac{L}{3} = 0 \rightarrow M_A = \frac{q_{max} L^2}{6}$$

